

OPERATION & MAINTANANCE MANUAL

Model : INARC – 401 ICOM

Inverter Based Arc Welding Machines



WARPP ENGINEERS PVT.LTD.

Survey No. 36, House No. 15/3, Unique Industrial Estate
Dhumal Nagar Vasai (East) Distt. Palghar (Maharashtra)
INDIA – PIN -401208

Tel: 8551817744 / 8551819944 / 8551817868 - 69 / 8551812002

Customer Care Tel : 8080808734

Email: service@warpp.co.in . Website: www.warpp.co.in

PREFACE

Thanks for purchasing our product & looking forward to your precious advice for improvement of our product. We will dedicate to produce the best products and offer the best services.

The machine has been carefully inspected both mechanically and electrically before it left the factory. The machine should be initially inspected upon receipt, if any damage which may have occurred in transit inform “**WARPP ENGINEERS PVT.LTD**”. Or it’s Dealer immediately. Check for the accessories supplied against those listed in packing slip.

Caution: Before attempting to connect the equipment to any Power source, read instructions carefully.

In case any defect or deficiency, contact “**WARPP ENGINEERS PVT.LTD.**” or its authorized Agent. Make sure to quote model number and serial number of the equipment in all correspondence.

The design of this equipment is subject to continuous development and improvements, consequently “**WARPP ENGINEERS PVT.LTD.**” reserves the right to incorporate minor changes from the information contained in this manual.

INDEX

- 1. Safety Precautions**
- 2. Product Description & Features**
- 3. Working Condition & Environment Required**
- 4. Technical Specification**
- 5. Working Principle**
- 6. Installation**
- 7. Controls**
- 8. Parameters & its operational meaning**
- 9. How to operate the machine**
- 10. Do's & Don'ts**
- 11. Trouble Shooting**
- 12. Wiring Diagram**
- 13. Maintenance**
- 14. Spare Part List**

1. Safety Precautions

General safety precaution:

-  Please strictly comply with rules defined in this manual to avoid unexpected accidents
-  How to connect to power supply, select working area and use pressure gas, please comply with proper rules
-  Not allow non-operator to enter working area
-  Machine's installation, inspection, maintenance, and manipulation must be completed by authorized person.
-  Don't use welding machine for unrelated purposes (Such as recharging, heating or plate cutting, etc.)
-  Must take safe precaution in case machine falling when it is put on the uneven ground

Avoid being electric shocked and burnt:

-  Never touch on the hot electrical units.
-  Please instruct the authorized electrician to ground the machine frame by using Proper-sized copper wire.
-  Please instruct the authorized electrician to connect the welder to power supply by using proper- sized, well-insulated copper wire.
-  When operating in the damp, space limited area, must ensure well-insulated between body and work piece
-  When operating in the high-rising location, must ensure safety by using safe net.
-  Please power off the input voltage while no longer using.

Avoid breathing in hazardous welding fume or gas:

-  Please use specified ventilation to prevent being gas poisoned and asphyxiated
-  Especially in the container where oxygen is depleted easily

Avoid being harmed by arc flash, hot spatter and slag:

-  Arc rays can injure your eyes and make your eyes feel uncomfortable.
-  Hot spatter and slag can burn your skin. Please wear proper welding helmet, leather gloves, long- sleeved suit, cap, apron and boot before welding.

Preventing fire, explosion, and container break accidents:

- ☒ Don't put flammable material in the working area. Hot spatter and hot weld can easily start a fire.
- ☒ Cable must be connected the work piece firmly to ensure good conductivity in case causing fire by resistance heat.
- ☒ Don't weld in the flammable gas or weld container which contains flammable material, otherwise it can cause explode.
- ☒ Don't weld encapsulated container, otherwise it can cause break.
- ☒ Ensuring a fire extinguisher at hand in case fire break out.



Avoid being hurt by moving parts:

- ☒ Never let the finger, hair, and cloth near the rotary cooling fan and wire feeder rollers.
- ☒ When feeding wire, don't let the bottom of gun near your eyes, face and body, to prevent being harmed by wire.



Avoid gas bottle falling or gas regulator breaking:

- ☒ Gas bottle must be firmly fixed on the ground, else if injure will exerts on.
- ☒ Never place bottle under high temperature or straight sun light.
- ☒ Never let your face near gas outlet while turning on the gas valve to prevent from being hurt by pressure gas.
- ☒ Customer should use the gas regulator provided by our company and comply with the proper instruction.



Avoid being hurt by welding machine while in transport:

- ☒ When moving the welding machine by fork-lift truck or crane, nobody can be allowed for standing downright the route of the moving welder, in case being hurt by the falling welding machine.
- ☒ The ropes or wires which used for hanging up the welding machine must be strong enough to withstand corresponding tension strength. The rope or wire inclination hanging on the tackle must be no more than 30°

2. Product Description & Features

This Series Inverter Arc welding machines is meant for Shielded Metal Arc

Welding (SMAW) only having rated current of 400 Amps. Which are novelty high-efficient and energy-saving DC Arc machines, not only are used in carbon steel, but also for stainless steel with its sound static and dynamic characteristic. This series machines have the following features:

1. Invert technology can assure welding current high stability and arc length consistency in fluctuating input supply. Welding arc enjoys high self-adjustability and high strength.
2. Low spatter
3. Easy to start arc
4. High deposit efficiency
5. Machine is having Adjustable Arc Striking
6. With remote control function, welding parameters can be adjusted at extended distance.
7. Light, small and portable.
8. High power factor, high efficient and energy saving

3. Working Condition & Environment

- 1) Please note that this equipment to be installed in a clean place free from dirt & moisture
- 2) Avoid direct exposure to sunlight
- 3) Care should be taken to see that it is not exposed to rain
- 4) Whenever the machine to be used at a site make sure proper shade is provided for the machine
- 5) Do not keep the machine near oven, furnace where temperature may be higher and it can affect the performance of the machine
- 6) Always keep the machines at lease with a gap of 300 mm around the machine as it is required for free circulation of air
- 7) Keep the machine in a flat position and if it is placed in an inclined position then the degree of inclination shall not be more than 15 degree
- 8) These machines can operate in the temperature range of 0 ~ 50 degree centigrade. When used over 40 degree centigrade the duty cycle of the machine may be lower than what is mentioned in the catalogue
- 9) Always connect the machine to the electric supply through a preferably D type MCB of suitable capacity
- 10) Use cables with proper cross section based on the input power requirement of the machine (Please refer to technical specification page for input power of the machine)
- 11) When long cables are used you need to select higher cross-sectional area of conductors to avoid voltage drop during the usage.

Selection guide for type of MCB

MCB Type	Tripping Current	Application
B Type	3 to 5 times the rated	Purely resistive load like lighting and

	current	general-purpose outlets
C Type	5 to 10 times the rated current	Moderate inductive load like air conditioners, residential / commercial pumps
D Type	10 to 20 times the rated current	Heavy inductive loads like heavy induction motor and welding machines

Selection of cable size for input supply

Please note that the cable size required for input supply depends on following:

- 1) Whether the machine is single phase or three phase
- 2) Input KVA of the machine
- 3) Distance from electrical supply point

First calculate the current the machine will draw based on the input **KVA** given (refer to technical specification page for this)

If the machine is a single-phase machine then each **KVA** would require around 4.6 Amps of current. That means if input **KVA** of the machine is 5 KVA, then it would draw 23 Amps at full load. If the machine is a three phase machine then each **KVA** would require around 1.4 Amps of current. That means if the input **KVA** of the machine is 5 KVA, then it would draw around 7 amps of current at full load

Cable capacity for copper cable can be taken as 6Amps /Sq. mm when cable length is less than 10 meters. That means 1 sq. mm cable can carry a current of 6 Amps of current

Now you have input current of the machine based on its input **KVA** You can calculate the conductor size by this formula,

Input current / capacity of conductor

Example: From the above for a single phase machine of 5 **KVA** you would need $23/6 = 3.8\text{Sq mm}$ cable. (You can choose 4sq mm cable)

From the above for a three phase machine of 5 **KVA** you would need $7/6=1.16\text{Sq mm}$ cable. (You can choose 1.5 sq. mm copper cable for each phase)

Note:

When the length of the cable is short the required cross section for input cable will Come down

Below table will help you in selecting the right size of welding cable based on the length and current to be used

Welding Cable selection chart


Welding Current in Amps	Recommended Cable size (Sq mm) based on length (in Mtrs)				
	Description	1 ~ 15 Mtrs	15 ~ 30 Mtrs	30 ~ 45 Mtrs	45 ~ 60 Mtrs
100		16	25	25	35
150		16	25	35	50
200	Primary power voltage/frequency	35	35	50	50
300	Rated input Power	50	50	70	95
400	Rated input current	70	70	70	95
600		95	95	95	
800	Rated duty cycle	140	140	60%	
1000		140	190		
1200		190	240		
1500		240	285		

Note:
Table given is just for reference and the actual result may vary depending on the quality of conductor
Multiple cables can be used where every single cable of that capacity is not available

Range of output current	20~400A
Open Circuit Voltage (OCV)	75 – 85 VDC
Full-load efficiency	89%
Power factor (at full-load)	0.95
Welding electrode diameter	2~4mm
Weight	22Kg
Dimension (L X W X H)	500 X 270 X 425 mm
Class of Insulation	Class - H

5. Working Principle


Block Diagram :

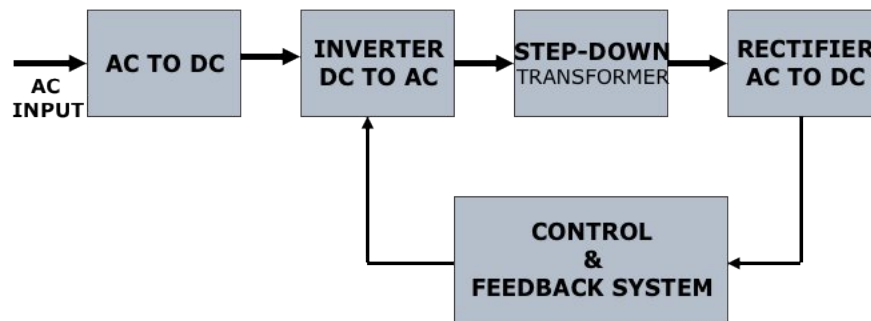

These power sources are used for various types of welding and they are based on IGBT inverter Technology. In these types of machines input supply is first converted in to DC by a rectifier circuit. The rectified voltage is then filtered and fed to an inverter section. This section will convert the DC to high frequency AC. In this case it is 20 K Hz AC. This AC voltage is fed to a specially designed high frequency transformer which steps down the voltage to acceptable welding voltage and increases the current to required level. The output of the transformer is fed to a high frequency rectifier circuit which converts this AC to DC for various welding applications.

In the case of machines having capability to deliver both and AC & DC outputs for welding, this DC is fed to one more inverter circuit OR electronic polarity control circuit which converts this in to low frequency AC output for Aluminum TIG application. In this case controls are provided for adjusting the AC frequency, AC balance along with other regular controls.

Block diagram with waveforms at different stages is given below for reference :

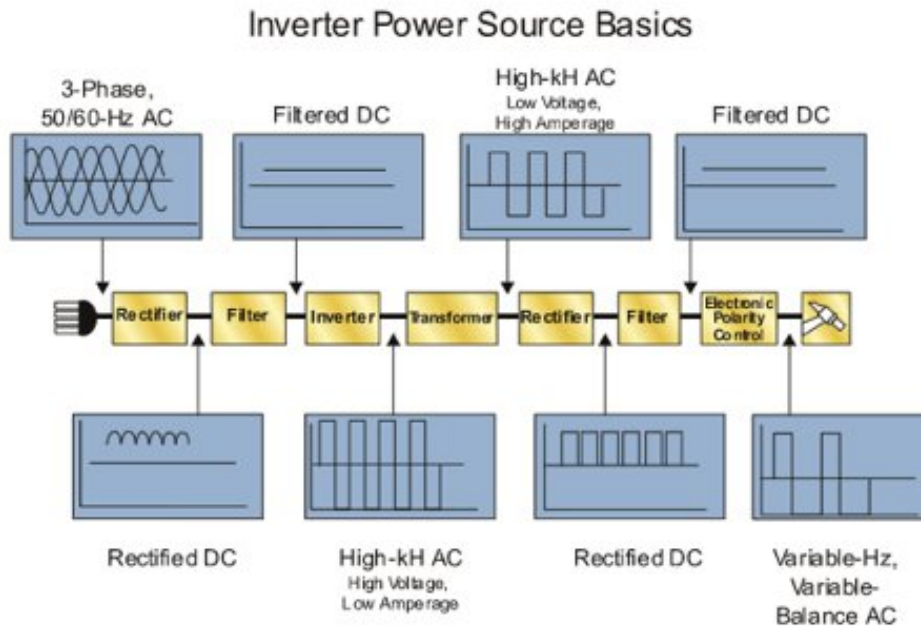

Different types of power sources are available for welding and most commonly used are as under


- Constant current (CC) power source
- Constant Voltage (CV) power source
- CC/CV power source

Please refer to the below chart for process-wise recommended power source types

Process	Power source type
SMAW	CC
GTAW	CC
GMAW /FCAW	CV
SAW	CV is commonly used and sometimes CC is used
Plasma Cutting	CC

Constant Current (CC) type power source

Constant current characteristics is also called as drooping characteristics. Typical V/I curve of such power source is shown below. Here the current remains stable even if the arc length varies. When there is change in arc length, change in the voltage is more when compared to change in current and hence they are called constant current type power source

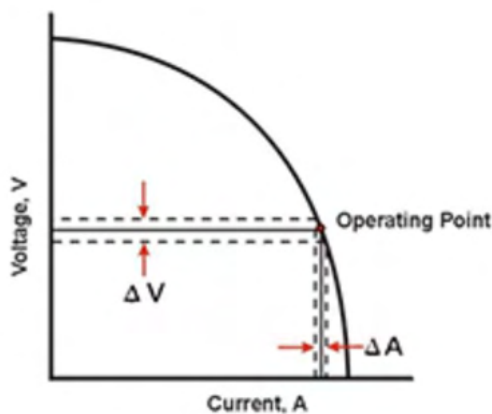

Relationship between the voltage and current for different process in CC type power source is as under

SMAW:

$$V = I * 0.04 + 20$$


GTAW:

$$V = I * 0.04 + 10$$

Constant Voltage (CV) type power source

Constant voltage characteristics are also called as Flat characteristics. Typical V/I curve of such power source is shown below. Here the voltage remains stable even if the arc length varies. When there is change in arc length, change in the current is more when

compared to change in voltage and hence they are called constant voltage type power source

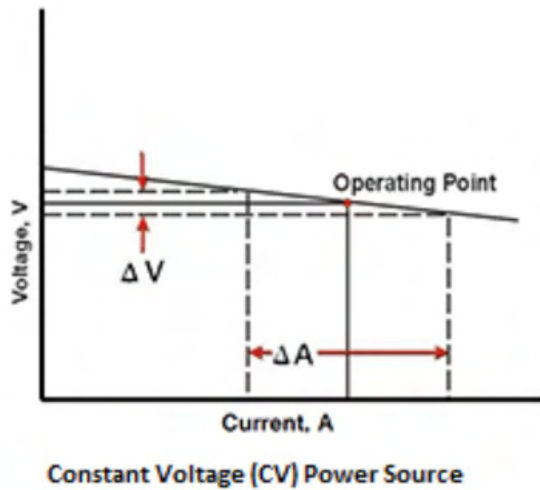

Relationship between the voltage and current for different process in CV type power source is as under

GMAW:

$$V = I * 0.05 + 14$$

FCAW:

$$V = I * 0.05 + 18$$

Note: Some power source have both CC and CV characteristics. The explanation given above is general and the capability of the machines depends on the model number of the machine purchased by you.

6. Installation

Installation:


1. Place the welding machine in the room where there is no straight sunlight, no rain, less dust, low humidity, and temperature range of 0° - 50°C.
2. The gradient of ground must not be more than 15°
3. Ensure no wind at the welding position, or use screen to block the wind.
4. The distance between welder and wall must be more than 300 mm.
5. Connect the 3 phase Input supply to the machine. Supply voltage must be in the range of 400 V +_ 10% as mentioned in the Technical specification of this manual.
6. Power supply:

■ The size of fuse and breaker in the table are for reference :

Product type		INARC – 401 ICOM
Power supply		3 phase AC 400 V
Min. power capacity		18.4KVA
Input protection	Fuse	30A
	breaker	32A
Mi. Cable size	Input side	4mm ²
	Output side	50mm ²
	Earth lead	4mm ²

7. Connect the electrode holder to the +Ve terminal & earthing cable to the +Ve terminal of the machine
8. Connect remote controller (If needed).

INSTALLATION DIAGRAM OF INARC – 401 ICOM

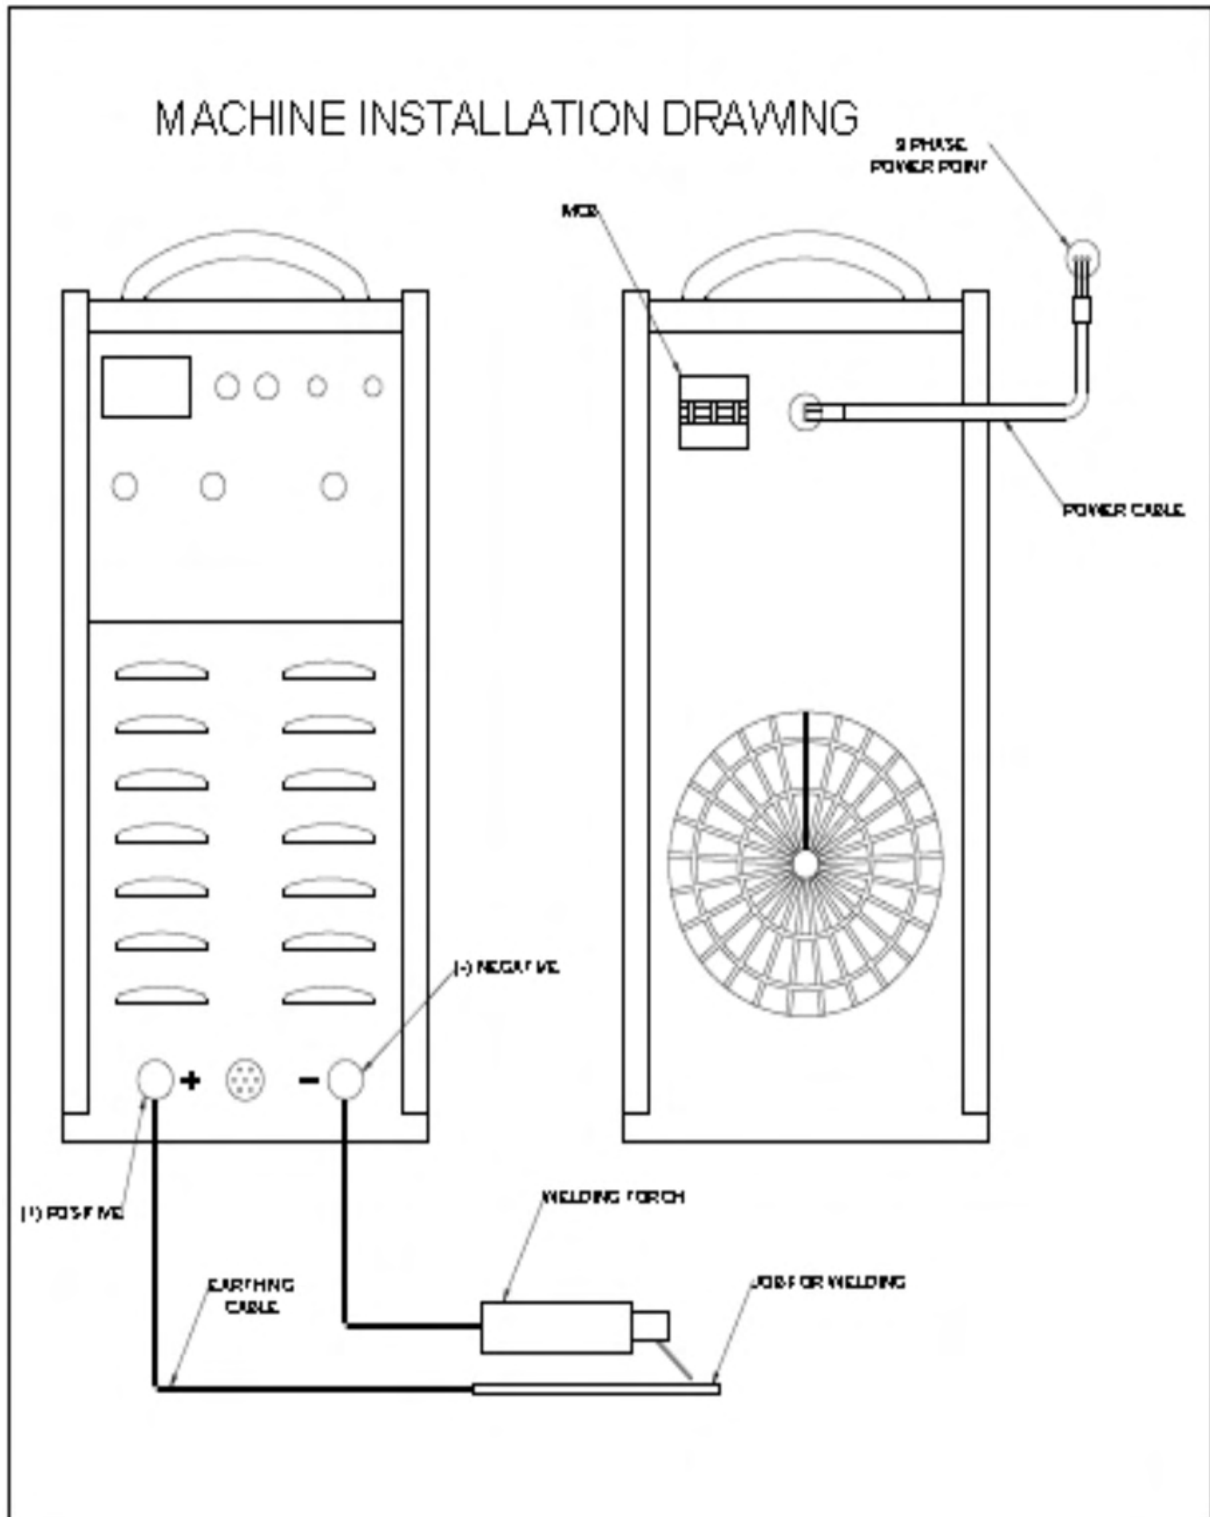

7. Controls



Front panel Details:

1. A/V Meter (Display) : It displays the output current or arc voltage during welding or OCV if not welding
2. Power LED: This indicator will on as soon as MCB of the machine is switched on
3. Protection LED : This LED will on if there is problem in the machine
4. A/V Selector Switch : This is selector switch to see the welding current or welding voltage.
5. Panel/Remote Selector Switch : This is also selector switch to set the output current of the machine. If it is kept on panel current can be adjusted from panel & if it is kept on remote then current can be adjusted through remote pendant away from the machine.
6. Welding Current Pot : This pot is meant for output current adjustment from panel
7. 7 Pin Connector : This is socket for remote control. it is optional accessories.
8. - Ve Terminal : This terminal is provided to connect the holder cable
9. + Terminal : This terminal is provided to connect the earthing cable connected to be job.
10. Arc Force : This pot is provided to adjust the arc force during welding

Back Panel :



1. Cooling Fan : It is provided to cool the machine while welding
2. MCB : This is provided to switch on or switch off the machine
3. Input Cable : This is provided to give the input supply to the machine

8. Parameters & its Operational meaning

Shielded Manual Metal Arc Welding (SMAW) or Electric Welding can be done by this Power Source. TIG welding process can be done by lift arc or scratch arc process. Welding parameters can be adjusted with the help of various pots available on the front panel.

- a) **Welding current** : Welding current of the welding process can adjusted with Welding current pot as per below chart :

Table 1 SMAW welding parameters

Work piece thickness (mm)	<1	2	3	4~5	6~12	≥13
Electrode diameter (mm)	1.5	2	3.2	3.2~4	4~5	5~6
Welding current (A)	30~50	40~60	90~110	90~130	160~250	250~400

- a) **Arc force**: Arc force is the extra voltage required during welding when welders hand is becoming up & down. It is in the percentage graduation according to arc voltage. It can be adjusted with the help of arc force pot provided on the front panel of the machine.
- b) **START CURRENT**: Start current is extra initial current to smooth start of welding. It is in the percentage as per welding current

9. How to operate the machine

1. Switch on the main switch for input supply provided for the machine
2. Switch on the MCB of the machine provided on the rear side of the machine
3. Set the output current as per required welding rod from panel or through remote
4. Start welding on the plate or job. Adjust the welding current as per requirement.
5. Switch off the machine when welding is over.
6. Switch off the main switch.


10. Do's & Don'ts

Do's	Don'ts
Clean the machine with compressed air @ $< 3 \text{ Kg/Cm}^2$	Don't keep any foreign material or plate on the top cover of the machine
Use proper polarity & current	Never use the higher current than recommended
Use proper welding cable size	Never use long cable if not required
Use proper welding angle	Never use long arc
Make firm connection of welding cable	Never use the joint of cable unless proper technique is used to join the cable
Keep the machine in proper shade to protect it from rain & direct sun light	Don't keep the machine in open ground or site


11. Trouble Shooting

SR.NO.	Trouble	Probable Cause	Remedy
1	MCB is on but welding is not starting	Check for 3 phase supply 1) MCB faulty 2) Control PCB faulty 3) Drive PCB faulty	Check and ensure Check & replace Check & replace Check & replace
2	MCB provided on the rear panel is tripping when it is being switched on	MCB faulty Three phase bridge faulty IGBT may faulty	Check and replace Check & replace Check & replace
3	Fluctuation in welding current	One Phase missing Panel/Remote switch faulty Main PCB faulty Drive PCB faulty POT of welding current faulty	Check and ensure Check & replace Check & replace Check & replace Check & replace
4	Welding current is not adjustable.	Pot of welding current faulty Main PCB faulty Panel/Remote switch faulty	Check and replace Check & replace Check & replace

12. Wiring Diagram

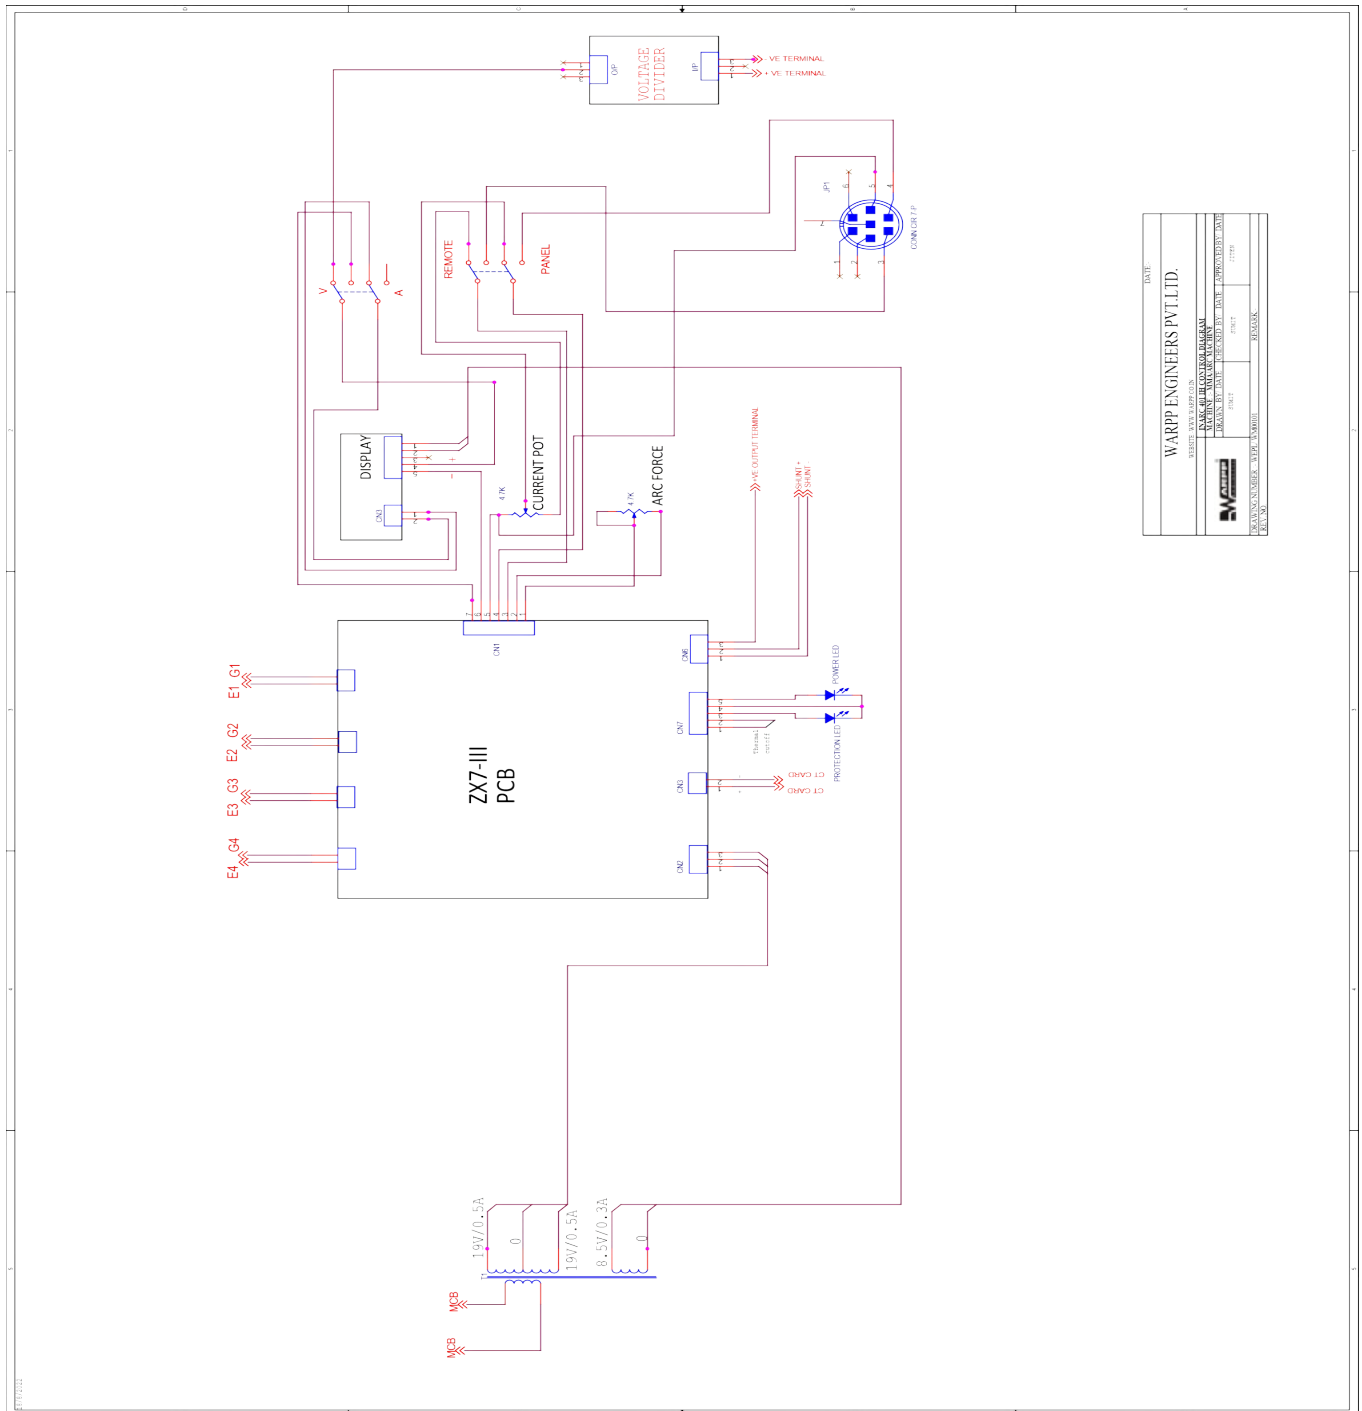

DATE	2023
WARPP ENGINEERS PVT. LTD.	
DESIGNED BY: WARPP ENGINEERS	
CHECKED BY: WARPP ENGINEERS	
APPROVED BY: WARPP ENGINEERS	
DATE: 2023	2023
PROJECT: 2023	2023
REVISION: 2023	2023

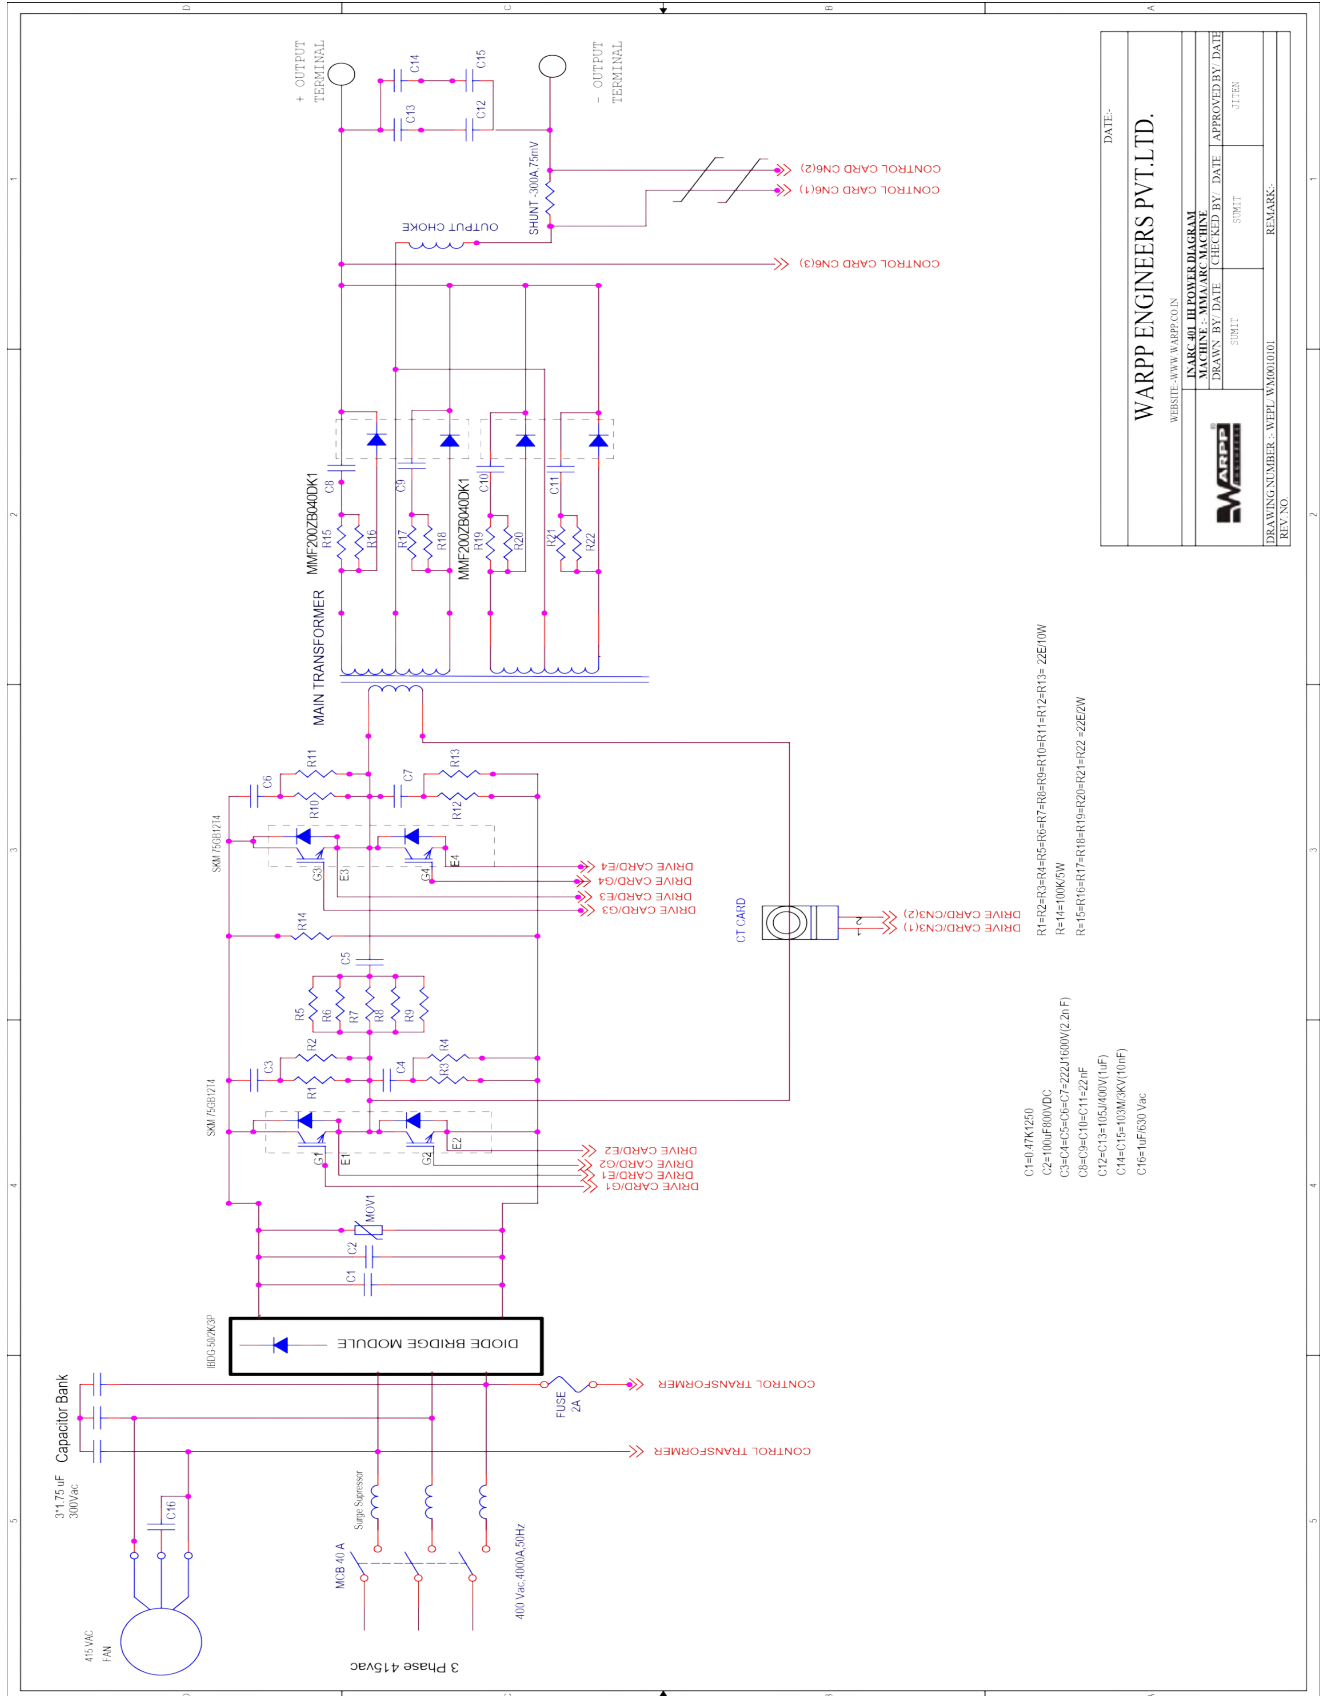

DATE:-			
WARPP ENGINEERS PVT.LTD.			
WEBSITE: WWW.WARPP.CO.IN			
IN ARC-JOB POWER DIAGRAM			
MACHINE: MMA/ARC MACHINE			
DRAWN BY: DATE	CHECKED BY: DATE	APPROVED BY: DATE	
STMT	STMT	STMT	JTEN
DRAWING NUMBER: WEPI-WA0001001		REMARKS:-	
REV. NO			

13. Maintenance

In principle, Machine's maintenance and repair should be completed by us or our authorized distributors. Customers can also solve the problems instructed by us or our authorized distributors.

Periodic inspection and maintenance:

- (1) Remove dust from power resource with compressed air by our authorized maintainer every 3- 4 months. Check if the bolt is loose.
- (2) Check frequently if control cables are worn out, adjusting knobs are loose, and components of panel are damaged.
- (3) Check output cable periodically, if jointers are loose or plugs are distorted, and then please repair it in time, otherwise the sockets will burn ou

Warning:

Don't open up side panel of the machine uninstructed, the max voltage inside the machine is 600VDC, which is very dangerous. Take safe precautions to prevent from being electric shock while maintenance.


14. Spare Part List

SR.NO	Description	Part Code
	Model	INARC – 401 ICOM
1	BRIDGE	SA00347
2	SNUBBER PCB (DIODE)	SA00042
3	SNUBBER CARD FOR INARC	SP03572
4	CABLE GLAND	SP00596
5	COPPER PATTI	SP08547
6	BUFFER	SP00575
7	THERMOSTATE	SP03779
8	IGBT	SP01871
9	PU CONNECTOR	SP02829
10	SNAP LUG	SP02106
11	MILITERY 7 PIN CONNECTOR(M)	SP00149
12	MILITERY 7 PIN CONNECTOR(F)	SP00148
13	HANDLE	SP01624
14	MCB	SP09528
15	CT CARD	SA00354
16	KNOB FOR POT	SP01979
17	JJ CARD	SA00029
18	OUT PUT CHOCK	SP00004
19	FAN	SP01327
20	EURO CONNECTOR	SP02683


21	CONTROL TRANSFORMER	SP00898
22	INPUT CABLE	SP01454
23	CAP-1uF 400V	SP00710
24	OUTPUT DIODE	SP02703
25	MAIN TRANSFORMER	SA00360
26	WELDING MACHINE BODY	SP09660
27	Control card	SP001874
28	Dc capacitor	SP01065
29	Digital panel meter	SP01103

SPARE PARTS IN DETAILS:


TOP VIEW

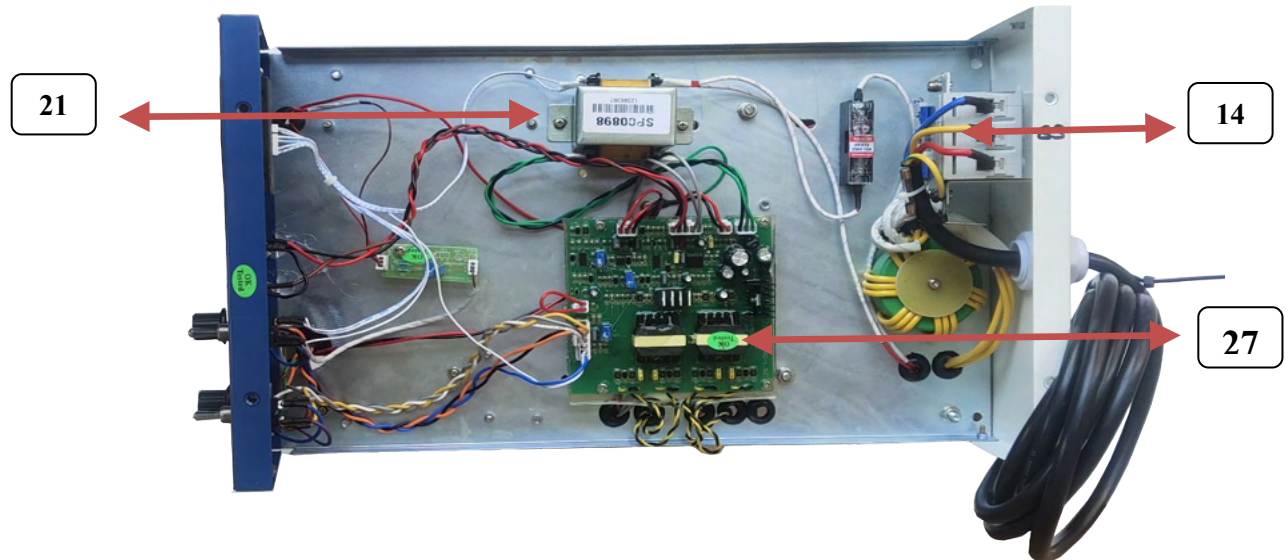

SIDE VIEW (LEFT)

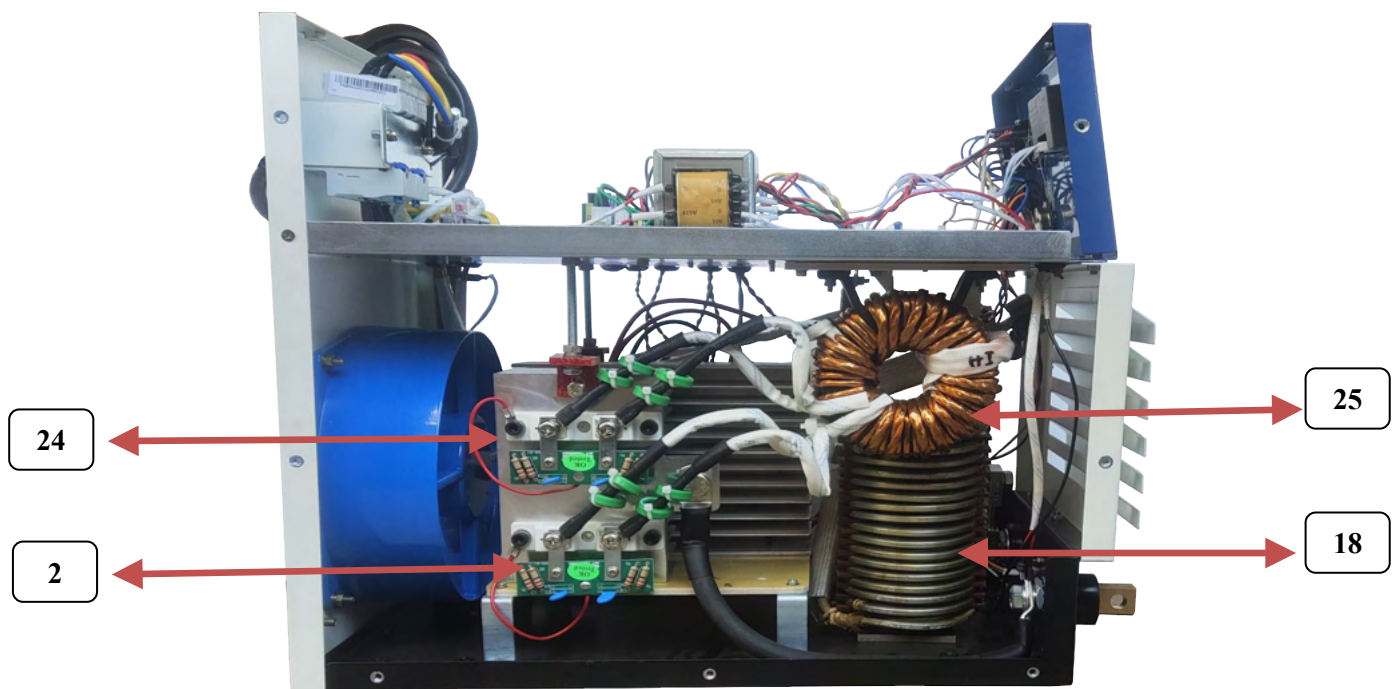

SIDE VIEW (RIGHT)

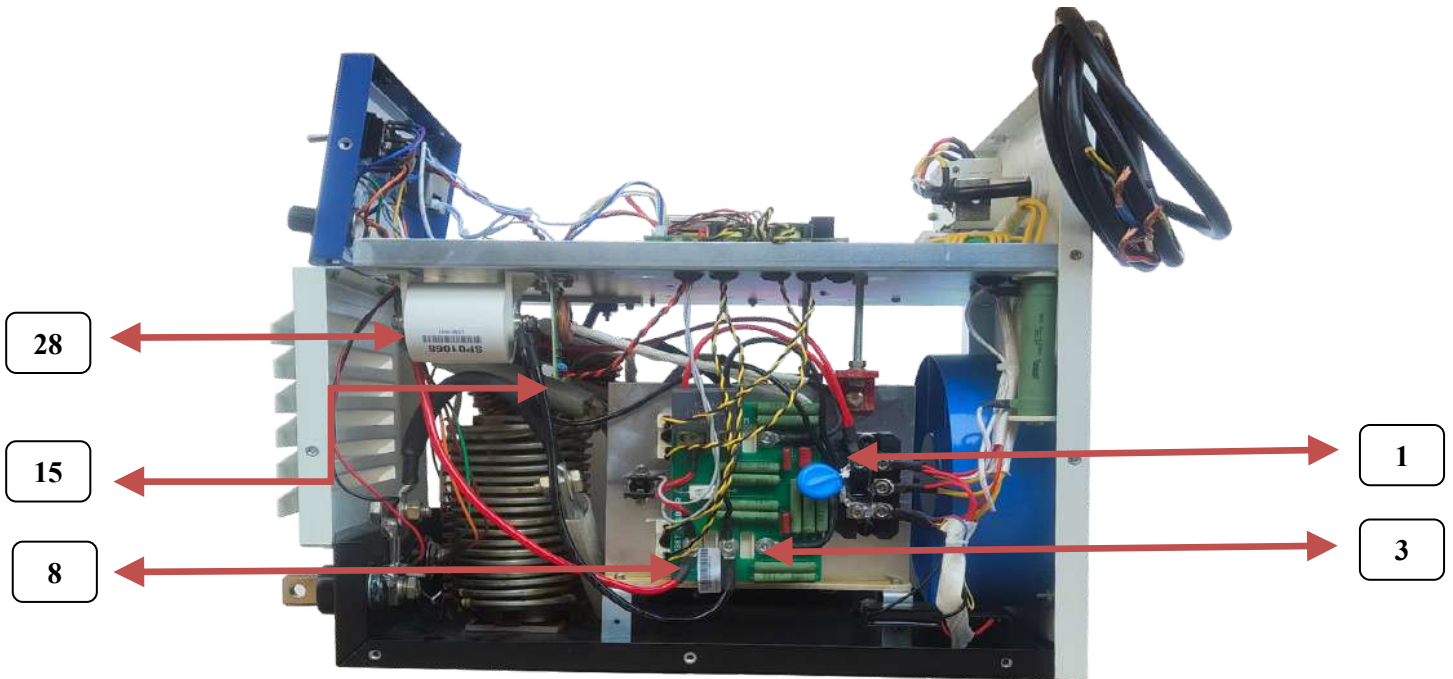

...END...